



TEMPERATURE MONITORING RELAY FOR PT100,
 UNDERSHOOTING OF 1 THRESH. VAL.,
 WIDTH 22ND5 MM -50 C-50 C,
 110-120/220-240V AC 1 NO + 1 NC,
 CLOSED-CIRC.PRINC. SCREW CONNECTION

General technical details:

type of voltage		AC
Supply voltage frequency		
<ul style="list-style-type: none"> • 1 / for auxiliary and control current circuit <ul style="list-style-type: none"> • initial rated value Hz 50 • final rated value Hz 60 • 1 / at 50 Hz / for AC / rated value V 110 • 1 / at 60 Hz / for AC / rated value V 110 • 2 <ul style="list-style-type: none"> • at 60 Hz / for AC <ul style="list-style-type: none"> • rated value V 230 • at 50 Hz / for AC <ul style="list-style-type: none"> • rated value V 230 		
Number of measuring circuits		1
Product function		
<ul style="list-style-type: none"> • defect storage No • reset external No 		
Measurable temperature		
<ul style="list-style-type: none"> • initial value °C -50 • final value °C 50 		

Item designation / according to DIN EN 61346-2		K
Item designation / according to DIN 40719 extendable after IEC 204-2 / according to IEC 750		K
Ambient temperature • during operating	°C	-25 ... +60

Mechanical design:

Design of the electrical connection • for auxiliary and control current circuit • jumper socket		screw-type terminals Yes
Design of the sensor / connectable		PT100 (resistance sensor)
Number of NC contacts / for auxiliary contacts		1
Number of NO contacts / for auxiliary contacts		1
Number of change-over switches / for auxiliary contacts		0
Width	mm	22.5
Height	mm	92
Depth	mm	91

Certificates/approvals:

General Product Approval



CCC



GOST



UL

Test Certificates

[Special Test Certificate](#)

other

[Declaration of Conformity](#)

[Environmental Confirmations](#)

Further information:

Information- and Downloadcenter (Catalogs, Brochures,...)

<http://www.siemens.com/industrial-controls/catalogs>

Industry Mall (Online ordering system)

<http://www.siemens.com/industrial-controls/mall>

Cax online generator:



<http://www.siemens.com/cax>

Service&Support (Manuals, Certificates, Characteristics, FAQs,...)

<http://support.automation.siemens.com/WW/view/en/3RS1010-1CK00/all>

Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, ...)

http://www.automation.siemens.com/bilddb/cax_en.aspx?mlfb=3RS1010-1CK00

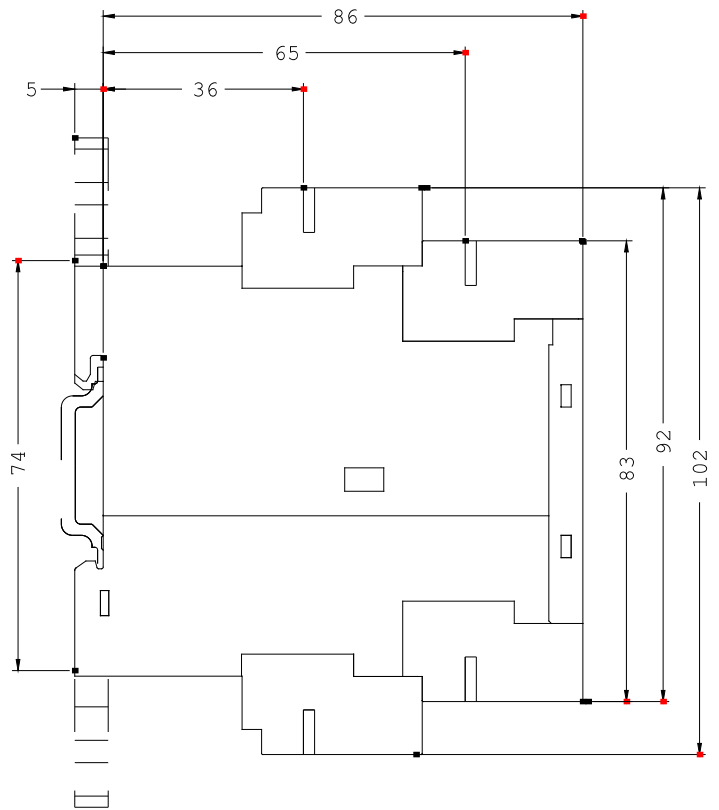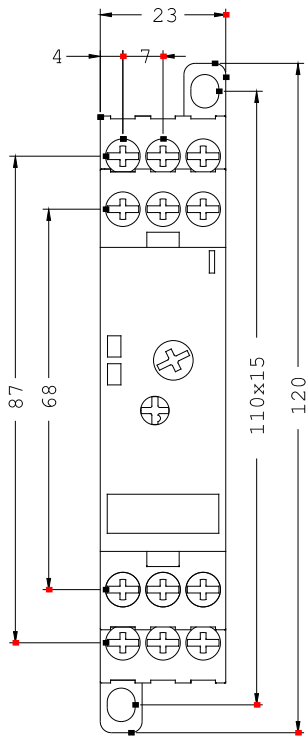

last change:

Jan 25, 2013